

# Vehicle Inspection Report

**Agreement No:**

**Reg:** CH53PRS

**CN:** VF15R5A0H49503532

Report Date: 24/04/2017 12:31PM

**NAMA Grade:** 3

Make: Renault	Fuel: D	Date First Reg: 31/03/2014
Model: Clio 0.9 D-QUE S M-NAV	Transmission: Manual	No Keepers:
Engine Size: 0.9	Gears: 5	Colour: RED
Doors: 5	Mileage: 25974	Soft Top: No
Body Type: Hatchback	Declaration: Not Checked	Taxi/Private Hr: No
Vendor: RCI Vision	Yr of Manu:	Acc Damage: No
Other:		

Extras	
Cassette Stereo:	No
CD Player:	No
Sunroof:	
Electric Windows:	4
Air Conditioning:	Yes
Cruise Control:	Yes
Power Steering:	Yes
Alloy Wheels:	Yes
Metallic Paint:	Yes
Leather:	No

Tyres		
	Make	Tread (mm):
Right Front:	Other	3
Left Front:	Other	3
Right Rear:	Michelin	3
Left Rear:	Michelin	3
Spare:	No	
Wheel trims:		

Interior Condition		
Clean:	Odour/Smoked in?: No	Valet:
Other:		


Miscellaneous	
Service History:	Full
Date Last Serviced:	31/03/2015
Registration Doc:	Here
MOT:	
Date of Expiry:	
Taxed To:	
Keys:	Yes
Master:	Yes
Spare:	Yes
No. Keys:	2



**Front Angle**



**Rear Angle**

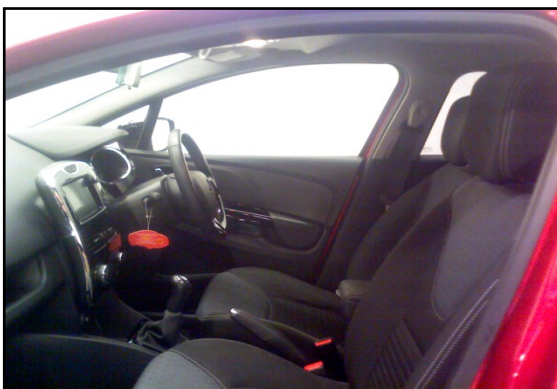

**Interior**



**SPEEDO**

Damage Location	Fault	Damage	Qty	Cost	Total
Wheel nsr	Scratched	Refinish	1	£40.00	£40.00
Wheel nsf	Scratched	Refinish	1	£40.00	£40.00
Wheel osf	Scratched	Refinish	1	£40.00	£40.00
Bonnet	Dented	Refinish	1	£113.00	£113.00
Tailgate	Dented	PDR Smart Repair	1	£20.00	£20.00
Wheel osr	Scratched	Refinish	1	£40.00	£40.00
Screen Front	Chipped	Glass Smart Repair	1	£40.00	£40.00
				Damage Cost Total:	£333.00
				Damage Cost Total (Inc VAT):	£399.60




**bonnet**



**nsf wheel**



**osf wheel**

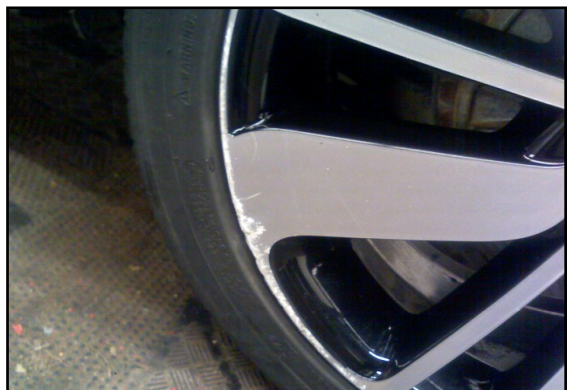

**nsr wheel**

Comments:  
front screen chipped would need attention

Print: David Murphy  
Date: 29/03/2017

CAP	
Cap Code:	58074
Cap Clean:	7025
Average:	6500
Below:	6025
Reserve:	6600