

Vehicle Inspection Report

Agreement No:

Reg: SFZ5101

CN: VF15R0G0H50553082

Report Date: 20/06/2017 12:44PM

NAMA Grade: 2

Make: Renault	Fuel: P	Date First Reg: 31/03/2014
Model: Clio 1.2 Dynamique Medianav	Transmission: Manual	No Keepers:
Engine Size: 1.2	Gears: 5	Colour: Red
Doors: 5	Mileage: 44819	Soft Top: No
Body Type: Hatchback	Declaration: Not Checked	Taxi/Private Hr: No
Vendor: RCI Vision	Yr of Manu: 2014	Acc Damage: No
Other:		


Extras	Tyres	Miscellaneous
Cassette Stereo: No	Make	Service History: Full
CD Player: No	Tread (mm):	Date Last Serviced: 09/11/2016
Sunroof:	Right Front: Continental 5	Registration Doc: Here
Electric Windows: 2	Left Front: Continental 4	MOT:
Air Conditioning: Yes	Right Rear: Continental 5	Date of Expiry:
Cruise Control: Yes	Left Rear: Continental 5	Taxed To:
Power Steering: Yes	Spare: No	Keys: Yes
Alloy Wheels: Yes	Wheel trims:	Master: Yes
Metallic Paint: Yes	Interior Condition	Spare: Yes
Leather: No	Clean: Odour/Smoked in?: No Valet:	No. Keys: 2
	Other:	



Front Angle



Rear Angle

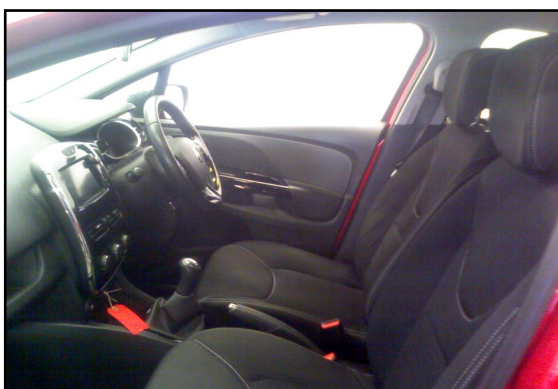

Interior



Speedo Reading

Damage Location	Fault	Damage	Qty	Cost	Total
Bumper Front	Scratched	Refinish	1	£86.00	£86.00
Qtr Panel nsr	Scratched	Machine Polish	1	£12.00	£12.00
Wheel nsr	Scratched	Refinish	1	£40.00	£40.00
Wheel nsf	Scratched	Refinish	1	£40.00	£40.00
Wheel osf	Scratched	Refinish	1	£40.00	£40.00
				Damage Cost Total:	£218.00
				Damage Cost Total (Inc VAT):	£261.60




nsf wheel



front bumper

Comments:

Print: David Murphy
Date: 15/06/2017


CAP	
Cap Code:	58071
Cap Clean:	5350
Average:	4925
Below:	4550
Reserve:	0